



Release Date: September 17, 2014

Version 2.0

Software Release Details

If your software is higher or equal to the versions listed below no action is needed.

Otherwise, please review this bulletin and consider taking actions as suggested.

Component	Version
System Software	061.132.224.23900
Network Controller	061.134.23820
UI	028.071.00042
IOT	093.072.000
Pre-Mod Tag Revision	093.072.000
IOT	095.039.000
w/Mod Tag 155	033.033.000
SIP	028.080.00025
DADH	025.020.000
Net Controller OS	061.064.23800

Purpose

This Bulletin is ONLY intended for the specific security problem(s) identified below. The problem(s) identified has been rated as a criticality level of **IMPORTANT**

CVE-2014-0224 (SSL/TLS MITM vulnerability). Must upgrade to OpenSSL 1.0.1h or OpenSSL 0.9.8za as applicable.

Installation Notes

Firmware Release File

The SPAR Software and installation notes are located here: http://www.support.xerox.com/support/workcentre-5735-5740-5745-5755/file-download/enca.html?contentId=122838

Save the file to a convenient location on your workstation. Unzip the file if necessary.

Read Me First:

When upgrading to 61.132.222.03800 or later from any release less than 61.132.222.03800, pre-upgrade patch 361374v1.dlm (found in the .zip file) may need to be installed before upgrading to this latest release. The pre-upgrade patch will retain the **Default Scan Template** settings that were made prior to loading 61.132.222.03800. If you upgrade to 61.132.222.03800 or later without loading the pre-upgrade patch first, the **Default Scan Template** settings will reset back to factory default at which point you will need to manually set the **Default Scan Template** to the desired settings.