

Mini Bulletin XRX15M

WorkCentre 75xx Series

SPAR Release 061.121.225.06100

Release Date: April 2, 2015

Version 1.1

Software Release Details

If your software is higher or equal to the versions listed below no action is needed. Otherwise, please review this bulletin and consider taking actions as suggested.

Component	Version
System Software	061.121.225.06100
Network Controller	061.125.06120LL
Copy Controller	061.125.00520
UI	061.125.04220
Marking Engine (Low Speed)	081.080.000
Marking Engine (High Speed)	082.080.000
Document Feeder	007.010.00000
Integrated Office Finisher	015.002.000
Office Finisher LX	007.002.000
Professional Finisher	032.052.000
FAX	003.010.017
Scanner	030.141.115

Purpose

This Bulletin is **ONLY** intended for the specific security problem(s) identified below. The problem(s) identified has been rated as a criticality level of **IMPORTANT**

- Includes fix for Vulnerability in the Bash command line interpreter AKA "Shellshock"
- Includes fix for SSLv3.0 Poodle Vulnerability (CVE-2014-3566)
- Includes fix for OpenSSL MiTM (Man in the Middle) Vulnerability
- Includes fixes for CVEs 2014-3505, 2014-3507, 2014-3508 and 2014-3510 (requires OpenSSL version updated to 0.9.8zb or higher)
- Includes fix for glibc (Ghost) vulnerability

Installation Notes

Firmware Release File

Release Install File	061.121.225.06100 or greater
----------------------	------------------------------

Notes:

- When upgrading to **061.121.222.06500** or later from any release less than **061.121.222.06500**, pre-upgrade patch **361372v1.dlm** (found in the .zip file with the release) may need to be installed before upgrading to this latest release. The pre-upgrade patch will retain the **Default Scan Template** settings that were made prior to loading **061.121.222.06500**. If you upgrade to **061.121.222.06500** or later without loading the pre-upgrade patch first, the **Default Scan Template** settings will reset back to factory default at which point you will need to manually set the **Default Scan Template** to the desired settings.
- For all finisher software upgrades a 'Forced Altboot' is necessary. Without a 'Forced Altboot' data loss will occur. Make a clone file prior to performing an Altboot and restore the clone file when the upgrade has completed.

The SPAR Software and installation notes are located here:

<http://www.support.xerox.com/support/workcentre-7545-7556/file-download/enca.html?contentId=122721>

Save the file to a convenient location on your workstation. Unzip the file if necessary